

HMMWV
DISTRIBUTION BOX UPDATE
The only power distribution box
deadlines your HMMWV is
446-7126 without a last
"VER 14.0A". A
until it fail. A
n

**HMMWV
DISTRIBUTION BOX UPDATE**

The only power distribution box that
deadlines your HMMWV is NSN 6110-01-
446-7128 without a label on it reading
"VER 14.04". Any other box is OK to use
until it fails. At failure, replace with NSN
6110-01-463-9260 (for Army users) or
NSN 6110-01-395-9585 (for Marine
Corps users).

New SEE Air Lines

new SEE Air Lines
Corrosion destroys the carbon steel air line that runs between the small emplacement excavator's pressure regulator and its air tanks. When you need a new air line, replace the carbon steel with stainless steel tubing, MSN 4710-01-384-6291, Pages 3-26 through 3-31 of TACOM EIR Digest TB 43-000-139-5 (June 95), the replacement instructions. See your TACOM LAR for a copy.

BRADLEY AMMO BIN SWITCH

BRADLEY AMMO BIN
Use NSN 5930-01-456-0530 to
order an ammo bin switch for
your M2A3/M3A2 ODS Bradley.
The NSN listed for Item 24 in
Fig 13A of TM 9-2350-284-
24P-2 is wrong.

DISTRESS MARKER BATTERY

To get light out of
distress marker lights,
NSN 6230-00-938-
1778 or NSN 6230-
00-067-5209, use
battery, NSN 6135-
00-073-8939.

**M989AI HEMAT
SHOCK ABSORBER**

**M989A1 HELIX
SHOCK ABSORBER**

MSN 2510-01-289-8286 gets the M989A1 trailer's shock absorber that's shown as Item 2 in Fig 22 of TM 9-2350-383-14&P. Make a note until the parts info is updated in the technical manual.

SEE Brake Reservoirs

Take Reservoirs

When you bleed the brake system of the excavator, keep the air pressure between 14.5 and 29 psi, like it says on Page 4- 263 of TM 5-2420-224-20. Higher air pressure can crack the reservoirs.

Painting PLS Flatracks

The palletized load system flatracks (M1077/M1077A1, M1 ISO compatible and M3/M3A1 CROPS) do not require camouflage pattern painting. When repainting is needed, use solid woodland green, tan or white CARC paint as required in your mission area. See TB 43-0209 for painting info.

REPLACING M2 GUN SPRINGS


REPLACING M2 GUN SPRINGS

Armorer, next time your M2 machine guns go to support for their annual inspections, make sure the sear helical spring, NSN 5360-00-209-8720, and flat adjustable trigger lever spring, NSN 5360-00-731-2029, are replaced. TACOM-Rock Island says the springs should be replaced every year. The requirement will be added to the PMCS in the next change to TM 9-1005-213-23&P.

**M120/M121 MORTAR
TRAINING INSERT**

M120/M121 TRAINING INSERT

The M303 sub-caliber insert for the M120/M121 mortar has a carrying case whose latches, hinges, and handles tend to break. Now you can replace them. Change 3 (Aug 01) to TM 9-1015-254-13&P added repair parts and instructions. The case repair kit, NSN 1015-01-414-4456, comes with two handles, two hinges, two latches, and an installation tool.

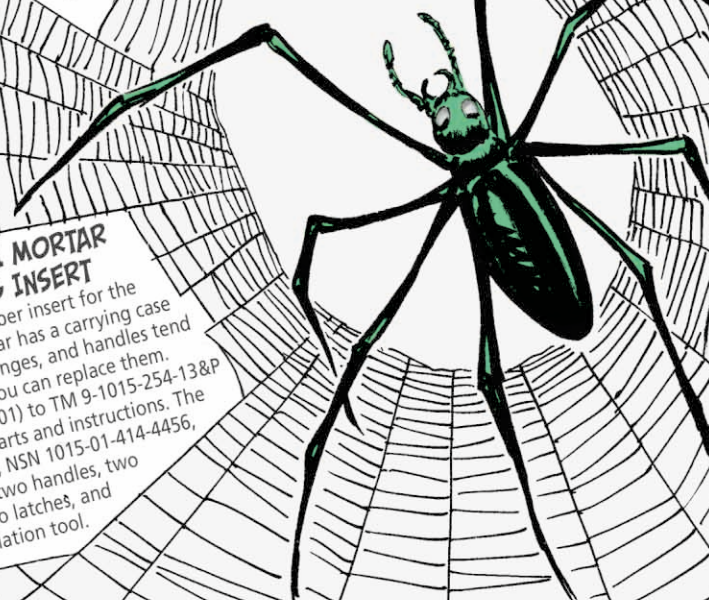

☆ U.S. GOVERNMENT
PRINTING OFFICE:
2002 - 750-124/00040

For sale by the
Superintendent of
Documents, U.S.
Government Printing Office
Washington, DC